


DC Wallbox Check CCS Relay Board

May. 02, 2019


D017_v1.0




1. Verify if there is any hardware damage

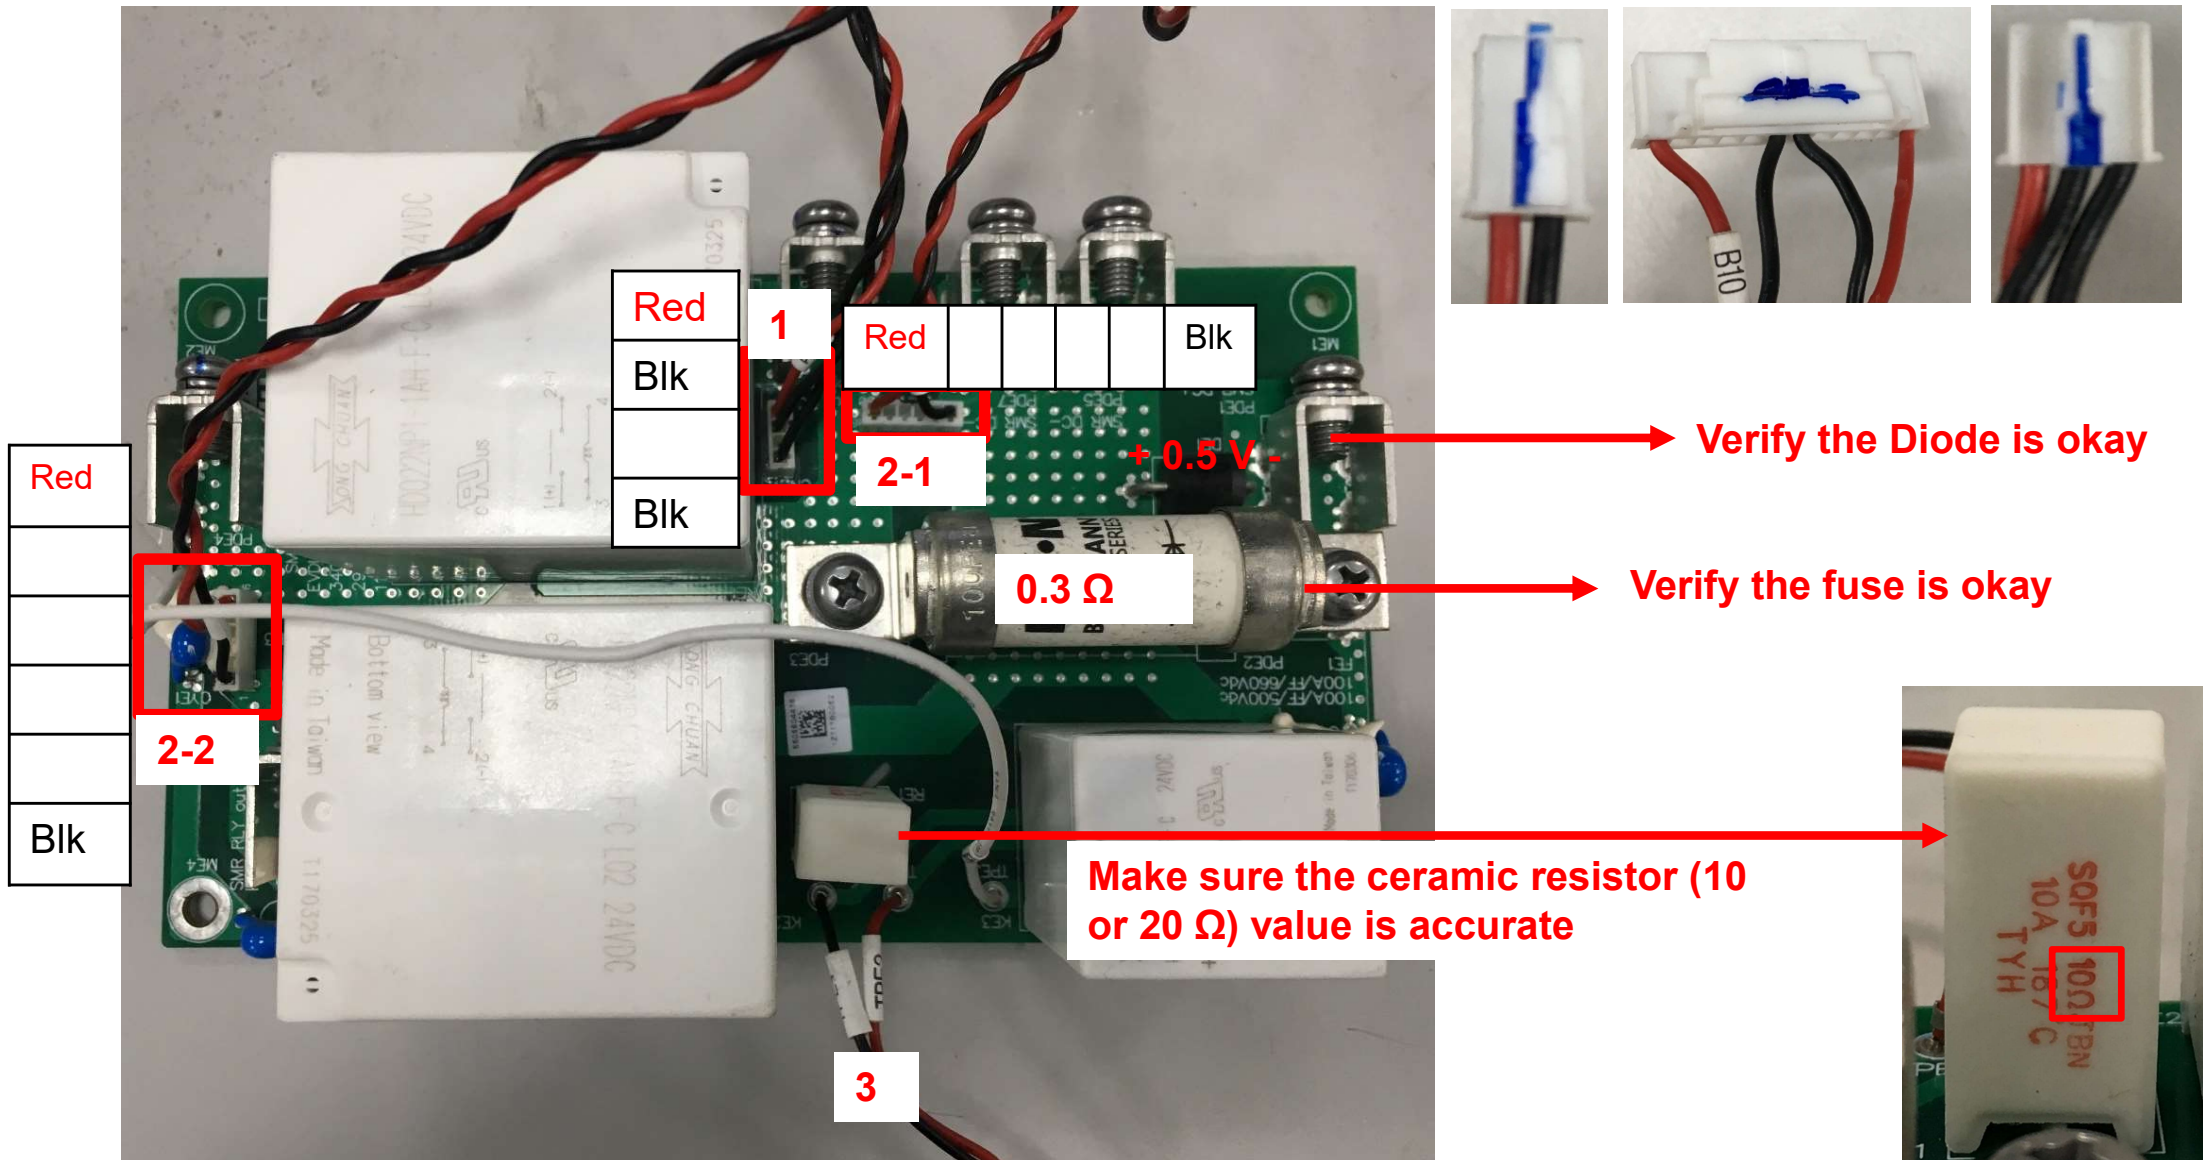

1. Supply 24V DC on the relay+ and – indicated in the image below and verify if the Relay Contactor is engaged (Relay Contactor should be closed and short)
2. Measure 10 Ohms resistor pin and make sure the value is accurate

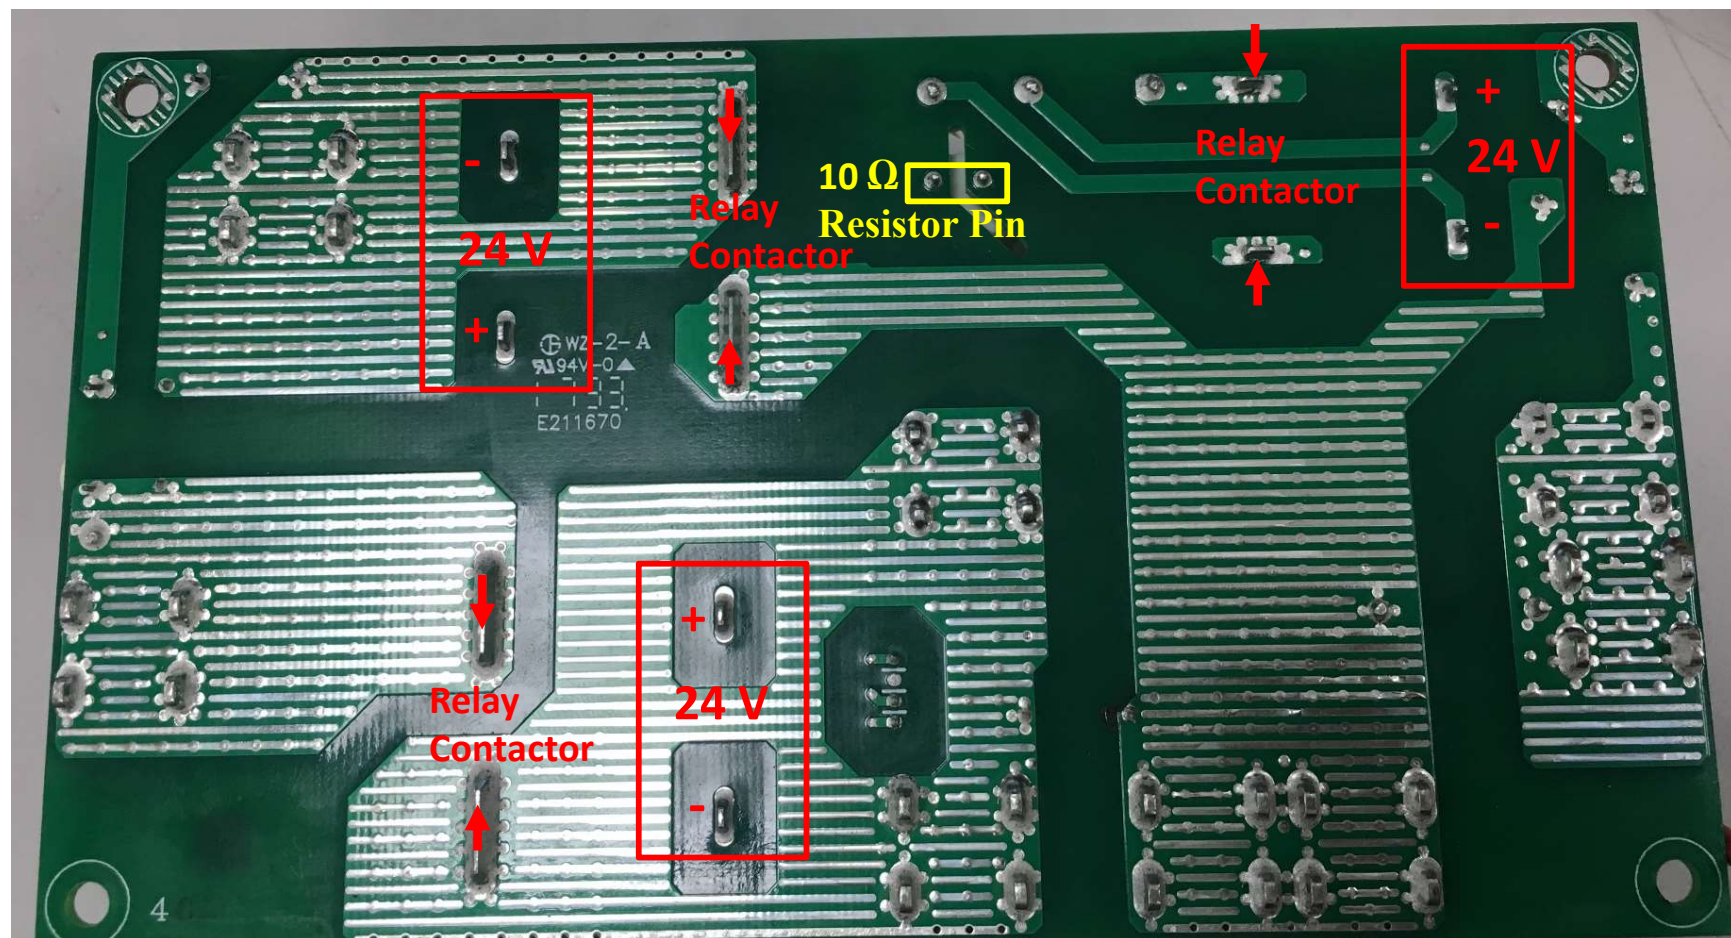


Red: SMR output
Yellow: SMR output after Fuse
Blue: System output after relay (= input for charging plug)

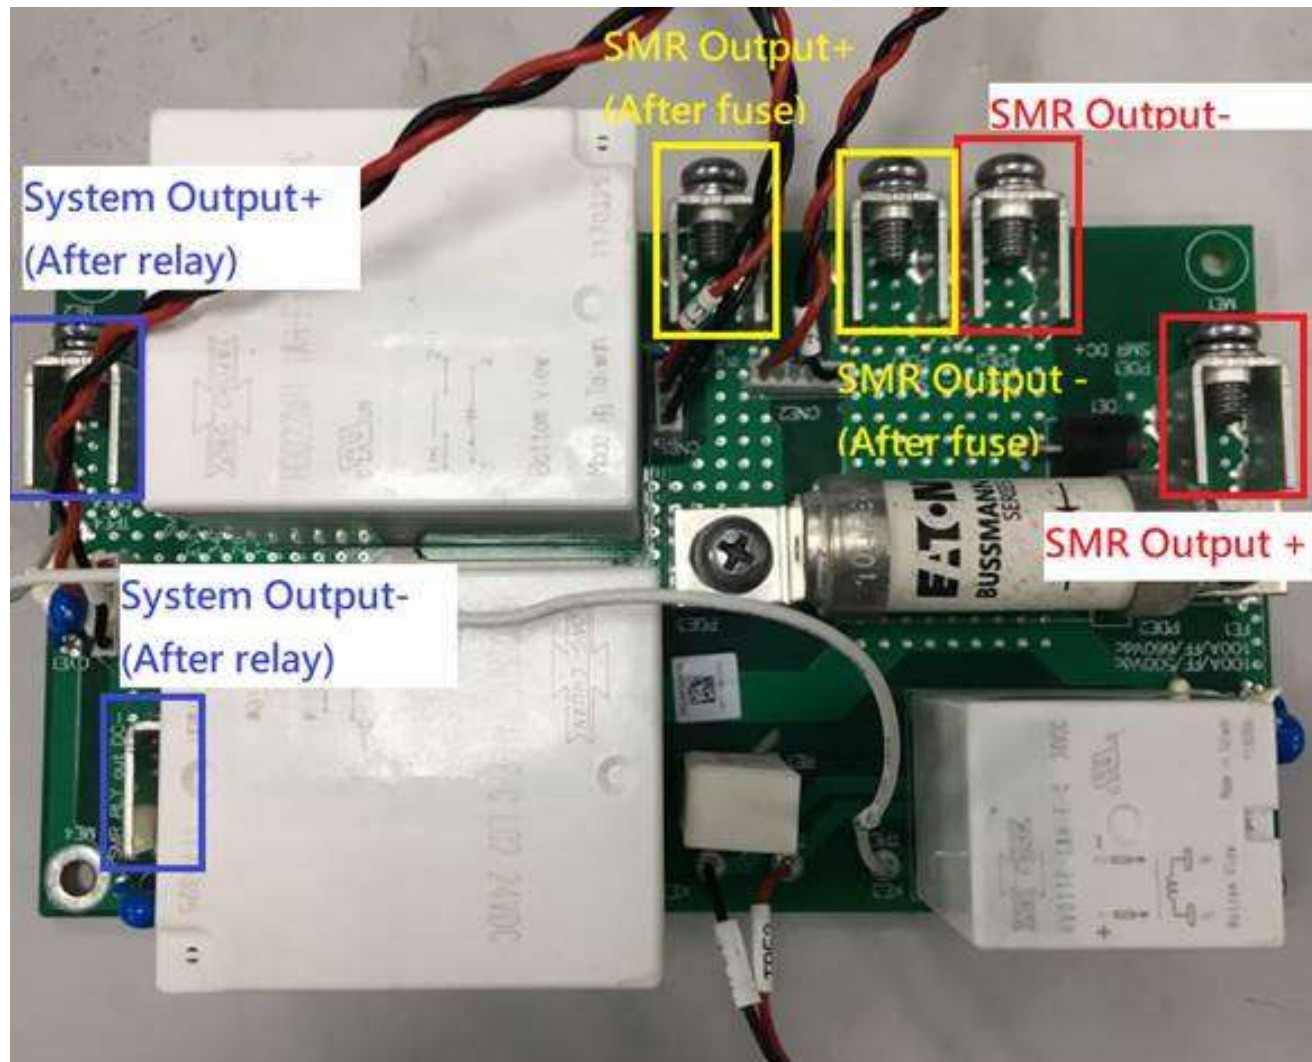


Cable check & Pre-charger

1. Cable check

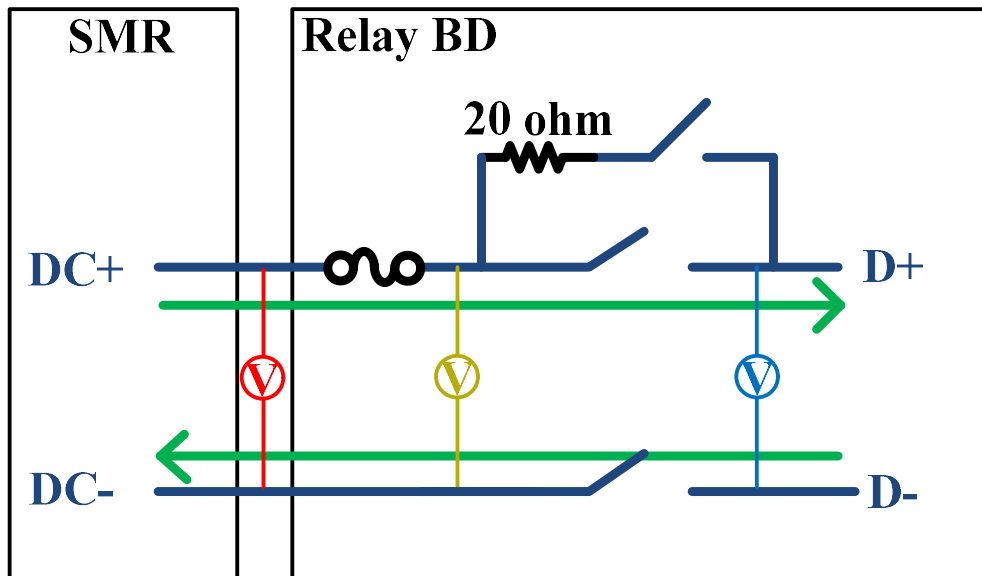

2. Pre-charge

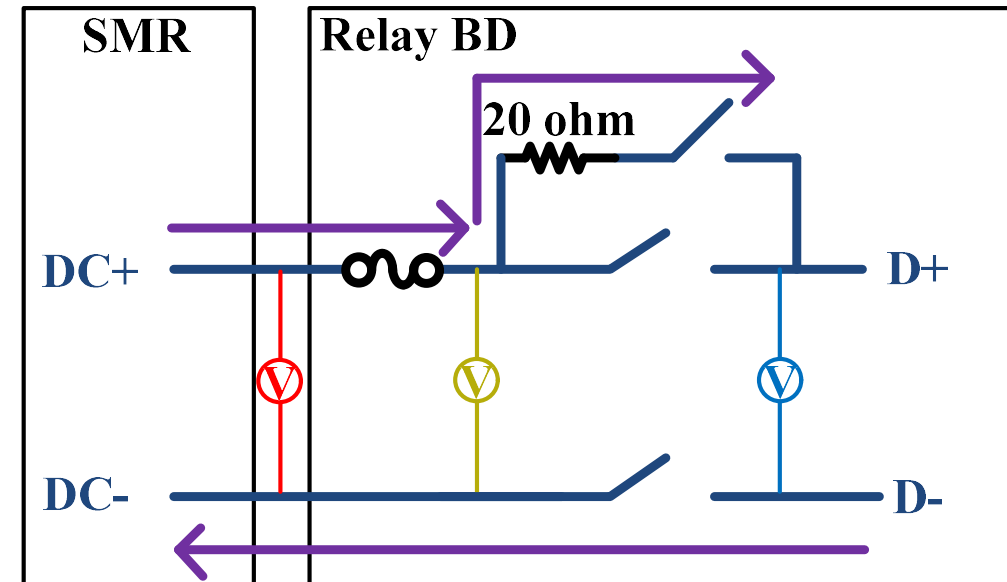

Smarter. Greener. Together.

To learn more about Delta, please visit www.deltaww.com.

