


# DeltaSolar

DELTA ELECTRONICS, INC.

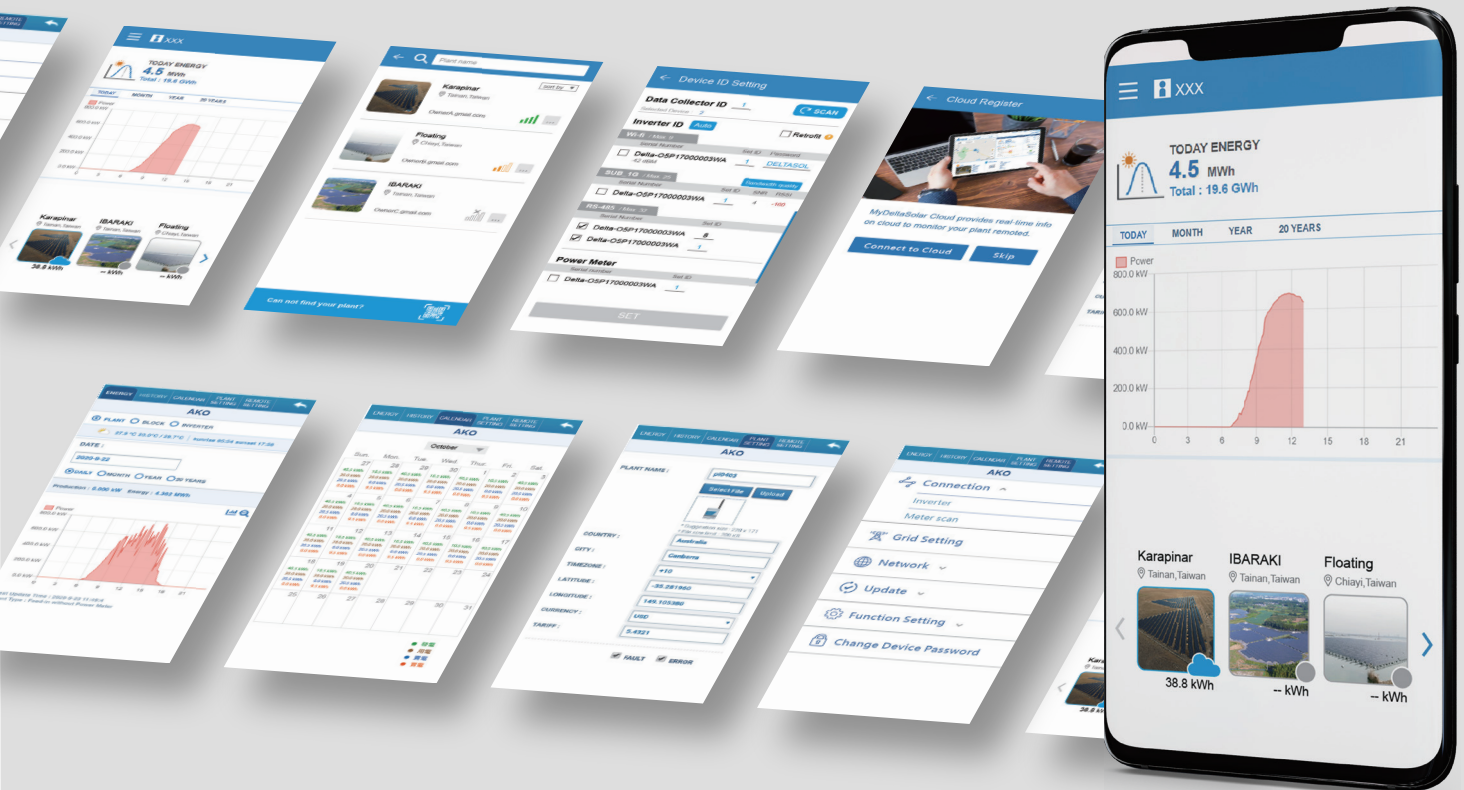

## DeltaSolar Application

### Operation Manual for **iOS** system

## 5.1.2. Inverter FW Update

### [Inverter FW Update - connection of DC1]

LOCAL SETTING -> Maintenance -> Inverter Firmware Update

Select the Inverter S/N for FW update.

Click "GET CURRENT FIRMWARE VERSIONS".

Click "OK".

Select the method to get Internet ability.

Select FW type, please confirm with local service for the FW type.

Click "YES".

Downloading...

After download complete, please click "UPDATE" to start process.

Click “OK”.

COMM : 01.01

DSP : 02.02

RED : 03.03

CS : 05

Inverter

Click on 'OK'. The APP will automatically direct you to the page for Data Collector connection.

ok

Firmware Type : COMM0122

Firmware Version : 01.22

Download Status : Finished

Update single inverter

Same Model Update

Updating...

COMM : 01.01

DSP : 02.02

RED : 03.03

CS : 05

Inverter

Please wait...

Success  
DC1 is updating inverter firmware version. Please wait about 35 seconds and APP will refresh the page

Firmware Type : COMM0122

Firmware Version : 01.22

Download Status : Finished

Update single inverter

Same Model Update

Success.

Inverter FW Update

Get current Firmware versions

Firmware Type :

Firmware Version : 01.22

Download Status : Finished

Update single inverter

Same Model Update

Update Status

Success


## [Inverter FW Update - connection of inverter]

LOCAL SETTING -> Maintenance -> Firmware Update


Enter Firmware update page.



Click "OK" the app will ask user connect to Internet.

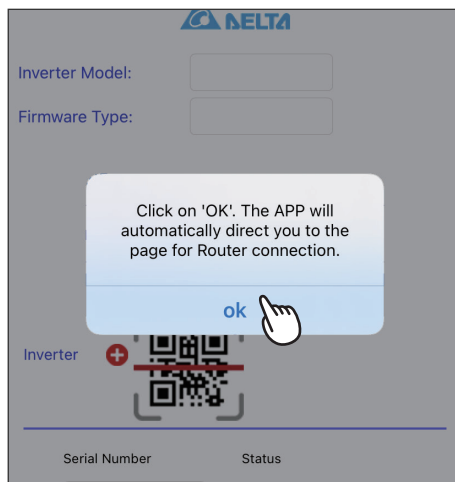


Select the method to get Internet ability.

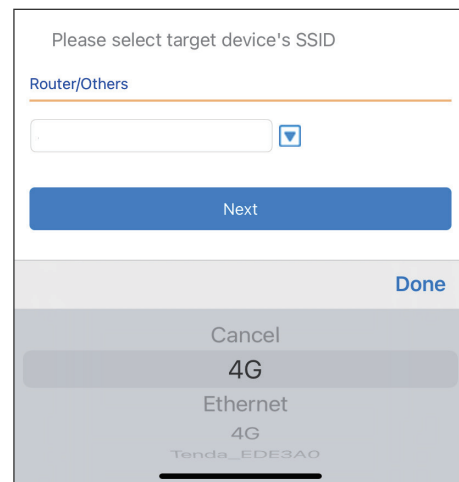

Click "Inverter Model".




Select the Inverter model for FW update.

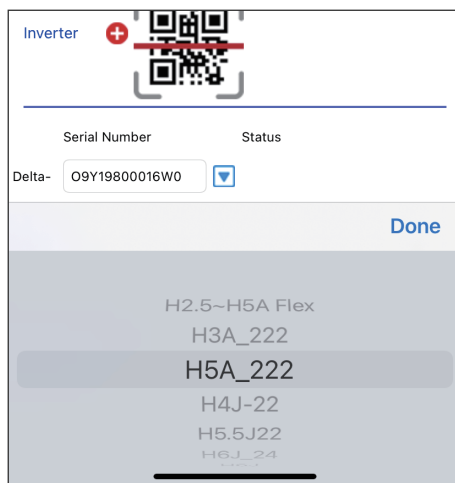


Select FW type, please confirm with local service for the FW type.




Click "Load Hex File".

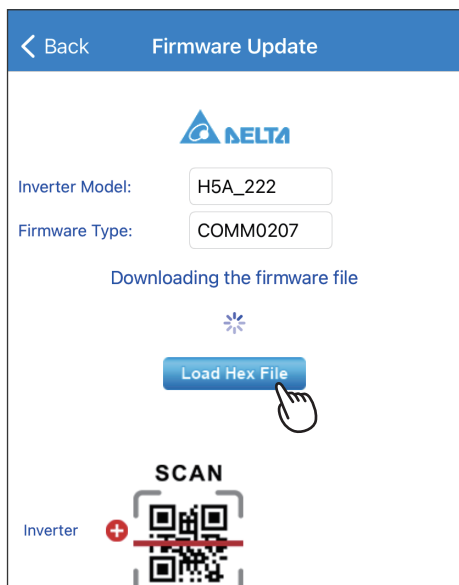

Select the Inverter serial number for FW update.

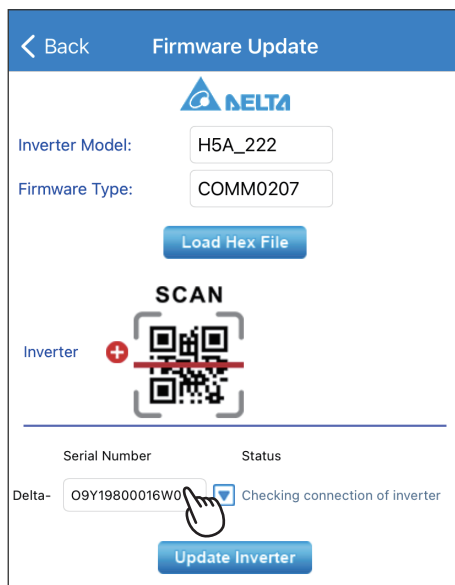

Click "Update Inverter".

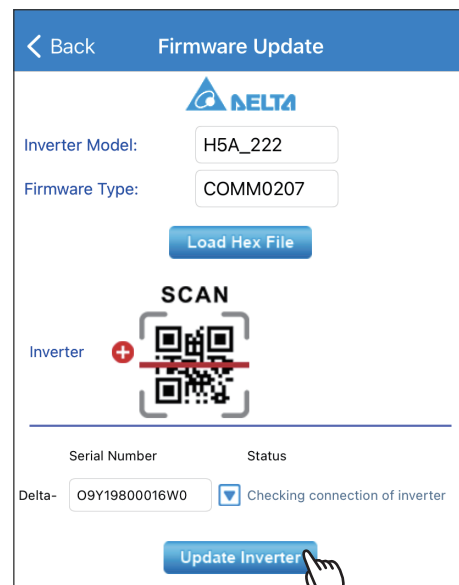

Upgrading...

Click "OK".

< Back

Firmware Update



Inverter Model:

H5A\_222

Firmware Type:

COMM0207

Load Hex File

Inverter

SCAN



Serial Number

Status

Delta-

O9Y19800016W0

Upgrading

Initial InterProcess Rate:43%



Firmware Version :

02.07

Information:

TCPGetPIDCmd done

ReqBoot1Tcp done

ReqBoot2Tcp done

ProcessorSelectTCP done

< Back

Firmware Update

Inverter Model:

H5A\_222

Firmware Type:

COMM0207

Load Hex File

Inverter

SCAN



Serial Number

Status

Delta-

O9Y19800016W0

Success

Update Inverter

Firmware Version :

02.07

Information:

BurnProcessTCP done

BankCloseProcTCP done

BurnDoneProcTCP done

InternalProcTCP\_final done

Total Tx Len :227968